

OPERATING INSTRUCTIONS



AR500



AR503



AR517



AR518

PROGRAMMABLE DIGITAL METERS



Thank you for choosing our product. These instructions will facilitate operating the device and enable safe use of the controller at its full capacity. Prior to the installation and startup of the device, please become familiar with these instructions. In the event of any additional questions, please contact our technical adviser.

CONTENTS

1. SAFETY PRINCIPLES.....	3
3. GENERAL CHARACTERISTICS OF THE METERS.....	3
4. CONTENTS OF THE SET.....	4
5. TECHNICAL DATA	4
6. ENCLOSURE DIMENSIONS AND INSTALLATION DATA.....	6
7. DESCRIPTION OF TERMINAL STRIPS AND ELECTRICAL CONNECTIONS	6
8. FUNCTIONS OF BUTTONS. MINIMUM AND MAXIMUM VIEW	7
9. BINARY INPUT	8
10. SETTING OF THE CONFIGURATION PARAMETERS	8
11. QUICK ACCESS MENU.....	12
12. ANALOG OUTPUT AND ALARM CONFIGURATION.....	12
12.1. CHANGING THE PRESET VALUE FOR THE ALARM AND THE MANUAL MODE.....	12
12.2. ANALOG OUTPUT.....	13
12.3. MANUAL AND REMOTE CONTROL FUNCTION.....	13
13. MESSAGE AND ERROR SIGNALING	13
14. CONNECTING THE CONTROLLER TO A COMPUTER AND AVAILABLE SOFTWARE.....	14
15. RS485 COMMUNICATION INTERFACE (acc. to EIA RS-485)	14
16. MODBUS–RTU SERIAL TRANSMISSION PROTOCOL (SLAVE)	15
17. USER'S NOTES	16



Please pay particular attention to the text marked with this sign.

The manufacturer reserves the right to make changes to the design and the programming of the device without any deterioration of the technical parameters.

1. SAFETY PRINCIPLES



- before you start to use the device, become familiar with the present instructions;
- in order to avoid electrocution or damage to the device, its mechanical and electrical installation must be performed by qualified staff;
- before switching on the power supply, make sure that all cables and wires are properly connected;
- before making any modifications to the wire and cable connections, switch off the device's power supply;
- ensure proper operating conditions compliant with the technical specification of the device (power supply voltage, humidity, temperature - see chapter 5).

2. INSTALLATION GUIDELINES



The device is designed so as to ensure an appropriate level of immunity to most interferences that may occur in industrial environments. In environments of unknown level of interferences, it is recommended to implement the following measures so as to prevent potential interference with the operation of the device:

- do not supply the device from the same lines as high-power equipment without using appropriate power line filters;
- use cable shields on power supply cables, sensor cables, and signal cables, whereby the earthing of the shield should be single-point and located as close to the device as possible;
- avoid running instrument (signal) cables in the direct vicinity of and parallel to power distribution and power supply cables;
- it is recommended to use twisted pair signal cables;
- in the case of sensing resistors in 3-wire connections, use identical wires;
- avoid locating remotely controlled, electromagnetic meters, and high-power loads, loads with phase or group power control, and other devices producing large impulse interferences close to one another;
- ground or zero metal rails on which rail-mounted devices are installed.

Make sure to remove the protective film from the LED display before the first use of the device.

3. GENERAL CHARACTERISTICS OF THE METERS

- measurement of temperature and other physical values (humidity, pressure, level, speed, etc.) processed to a standard electrical signal (0/4÷20mA, 0÷10V, 0÷60mV, 0÷2,5kΩ);
- 1 universal measurement input (thermoresistance, thermocouple, and analog) with memory of the minimum and maximum measured value and a remote data display function (over the MODBUS-RTU protocol); (except for AR500)
- programmable digital input (except for AR500) for changing the operation mode of the meter: manual/automatic mode for the analog output, keypad block, stopping the display indications (HOLD function)
- analog output (except for AR500) 0/4÷20 mA or 0/2÷10 V (retransmission, alarm/control, manual)
- manual mode for the analog output (open control loop) enabling setting the output signal value in the range of 0-100% (except for AR500)
- digital LED readout with programmable color (only AR517) and illumination brightness
- signaling of alarm status with variable display color (only AR517)
- integrated 24 V DC power supply supplying the field transducers (except for AR500)
- RS485 serial interface (galvanically isolated, MODBUS-RTU protocol, except for AR500)
- compensation of line resistance for resistance sensors and of temperature of cold thermocouple tips;
- programmable type of input, range of indications (for analog inputs), alarm, display, communication, and access options, and other configuration parameters
- access to configuration parameters protected with a user password
- parameter configuration methods:

- from the film keypad located on the front panel (in AR500 and AR503 the buttons are accessible after the front glass is taken out)
- through the RS485 or the AR955 programmer and the ARSOFT-WZ1 free software (Windows 2000/XP/Vista/7/8)
- software and the AR955 programmer that enables viewing the measured value and quick configuration single or ready sets of parameters pre-saved on the computer in order to be used again, for example in other meters of the same type (duplication of configuration)
- panel enclosure (on the front side: IP65 - AR517, IP54 - AR500, AR503, AR518)
- wide range of supply voltages (18÷265 Vac / 20÷350Vdc)
- built-in power supply for field transducers 24Vdc/30mA (does not apply to AR500)
- optionally (to be selected at the time of order): 24 V AC/DC power supply, analog output 0/2÷10 V and RS485 interface (does not apply to AR500)
- high accuracy, long-term stability, and immunity to interferences;
- available accessories:
 - AR955 programmer
 - RS485/USB converter



NOTE: 

Before starting to work with the meter, you must become familiar with these operating instructions, properly prepare the electrical system and the mechanical system, and correctly configure the parameters.

4. CONTENTS OF THE SET

- a meter with grips for installation in a panel window
- operating instructions
- a warranty card

5. TECHNICAL DATA


1 universal input (set with parameter 0: )	measurement range
- Pt100 (RTD, 3- or 2-wire)	-200 ÷ 850 °C
- Ni100 (RTD, 3- or 2-wire)	-50 ÷ 170 °C
- Pt500 (RTD, 3- or 2-wire)	-200 ÷ 620 °C
- Pt1000 (RTD, 3- or 2-wire)	-200 ÷ 520 °C
- thermocouple J (Fe-CuNi)	-40 ÷ 800 °C
- thermocouple K (NiCr-NiAl)	-40 ÷ 1,200 °C
- thermocouple S (PtRh 10-Pt)	-40 ÷ 1,600 °C
- thermocouple B (PtRh30PtRh6)	300 ÷ 1,800 °C
- thermocouple R (PtRh13-Pt)	-40 ÷ 1,600 °C
- thermocouple T (Cu-CuNi)	-25 ÷ 350 °C
- thermocouple E (NiCr-CuNi)	-25 ÷ 820 °C
- thermocouple N (NiCrSi-NiSi)	-35 ÷ 1,300 °C
- current ($R_{in} = 50 \Omega$)	0/4 ÷ 20 mA
- voltage ($R_{in} = 110 \text{ k}\Omega$)	0 ÷ 10 V
- voltage ($R_{in} > 2 \text{ M}\Omega$)	0 ÷ 60 mV
- resistance (3- or 2-wire)	0 ÷ 2,500 Ω
- remote data display (through the RS485 or PRG port)	-1999 ÷ 9999
Response time (10 ÷ 90%)	0.25 ÷ 3 s (programmable with parameter 1: )

Resistance of leads (RTD, Ω)		$R_d < 25 \Omega$ (for each line)
Resistance input current (RTD, Ω)		400 μA (Pt100, Ni100), 200 μA (others)
Processing errors (at ambient temperature of 25 °C):		
- basic	- for RTD, mA, V, mV, Ω	0.1% of the measurement range ± 1 digit
	- for thermocouples	0.2% of the measurement range ± 1 digit
- additional for thermocouples		$< 2 \text{ }^\circ\text{C}$ (temperature of cold tips)
- additional from ambient temperature changes		$< 0.003\%$ of the input range $^\circ\text{C}$
Resolution of measured temperature		programmable, 0.1 $^\circ\text{C}$ or 1 $^\circ\text{C}$
Range of indications (resolution of analog inputs)		-1999 \div 9999, programmable
Position of the decimal point for analog inputs		programmable, 0 \div 0.000
Binary input (none in the AR500)		contact or voltage $< 24 \text{ V}$, bistable, active level: short circuit or $< 0.8 \text{ V}$
Communication interfaces (RS485 and PRG, do not use simultaneously)	-RS485 (galvanically separated), option, none in the AR500	- speed 2.4 \div 115.2 kb/s, - character format 8N1 (8 data bits, 1 stop bit, no parity bits) - MODBUS-RTU protocol (SLAVE)
	- PRG programming connection (no separation), standard	
Analog output (none in the AR500) (1 current or voltage, not separated from the input)	- current 0/4 \div 20 mA (standard)	maximum resolution 1.4 μA (14 bit) load capacity of the load $R_o < 350 \Omega$
	- voltage 0/2 \div 10 V (option)	maximum resolution 0.7 mV (14 bit) load capacity of the output $I_o < 3.7 \text{ mA}$ ($R_o > 2.7 \text{ k}\Omega$)
	- basic error of the output	$< 0.1\%$ of the output range
7-segment LED display - 4 digits with programmable color (only AR517), parameters 17: color , 18: field) and brightness (16: br id)		AR517 - 20 mm, 5 colors (red, dark- and bright-orange, yellow, green), AR518 - 25 mm, AR503 - 14 mm, AR500 - 10 mm (blue), red
Signaling of alarms, messages, and errors		LED display, variable display color in AR517
Power supply (Usup, universal, according with standard 24Vac/dc, 48Vac/dc, 110Vac, 230Vac, e.t.c)		85 \div 260 V AC/ 3 VA (none in the AR500) AR500: 20 \div 50 VAC/ 3 VA, 20 \div 72 VDC/ 3W others 20 \div 350Vdc/3W
Power supply of field transducers (none in the AR500)		24 VDC / 30 mA
Rated operating conditions		0 \div 50 $^\circ\text{C}$, $< 90\%$ RH (no condensation)
Operating environment		air and neutral gases
Protection rating	- on the front side	IP65 - AR517, IP54 - AR500, AR503, AR518
	- on the connections side	IP20
Weight		AR517 (approx.165 g), AR518 (approx.295 g), AR500 (approx.60 g), AR503 (approx.100 g)
Electromagnetic compatibility (EMC)		immunity: according to the PN-EN 61000-6-2:2002(U) standard
		emissivity: according to the PN-EN 61000-6-4:2002(U) standard

6. ENCLOSURE DIMENSIONS AND INSTALLATION DATA


a) AR517

Enclosure type	panel, Incabox XT L57
Material	self-extinguishing NORYL 94V-0, polycarbonate
Enclosure dimensions	96 x 48 x 79 mm
Panel window	92 x 46 mm
Fixing methods	grips on the side of the enclosure
Conductor cross-sections	2.5 mm ² (power supply), 1.5 mm ² (others)

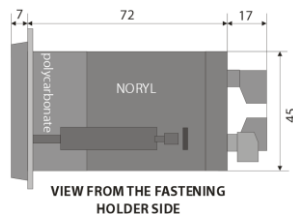


Enclosure type	panel, Incabox L57
Material	self-extinguishing NORYL 94V-0
Enclosure dimensions	144 x 72 x 72 mm (W x H x D)
Panel window	138 x 67 mm (W x H)
Protective cover IP54	AR967 (option)
Fixing methods	grips on the side of the enclosure
Conductor cross-sections	2.5 mm ² (power supply), 1.5 mm ² (others)

b) AR518

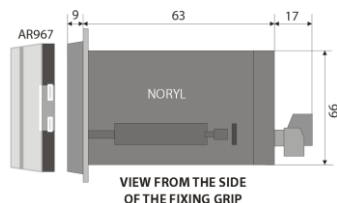

c) AR500, AR503

Panel enclosure	MULTIBOX - 482472 (AR500), 722408 (AR503)
Material	self-extinguishing NORYL 94V-0
Enclosure dimensions	48x24x79 mm (AR500), 72x24x79 mm (AR503)
Panel window	44x21 mm (AR500), 68x22 mm (AR503)
Fixing methods	grips on the side of the enclosure
Conductor cross-sections	2.5 mm ² (power supply AR503), 1.5 mm ² (others)

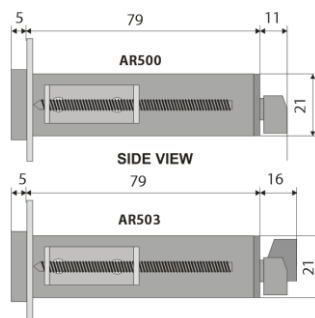


7. DESCRIPTION OF TERMINAL STRIPS AND ELECTRICAL CONNECTIONS

Table 7. Numbering and description of terminal strips


Clamps	Description
1-2-3	input Pt100, Ni100, Pt500, Pt1000, resistance, (2- and 3-wire)
2-3	thermocouple input TC (J, K, S, B, R, T, E, N) and voltage input 0÷60 mV
3-5	current input 0/4÷20 mA
4-5	voltage input 0÷10 V
6 (none in the AR500)	output +24 V (in relation to the 5-GND) of the integrated power supply of field transducers
5-7 (none in the AR500)	binary input (contact or voltage <24 V)
5-8 (none in the AR500)	analog current output (0/4÷20 mA) or voltage output (0/2÷10 V)
PRG	programming connection for cooperation with the programmer (only AR955)
9-10 (none in the AR500)	RS485 serial interface (MODBUS-RTU transmission protocol)
12-13	power supply input 230 VAC or 24 VAC/DC (in AR500 only 24 VAC/DC)

a) numbering of the connections on the back panel, method of connecting sensors and measurement signals and the PRG adapter in AR500 and AR503 (description of terminal clamps - Table 7)


a.1) in AR517, AR518, AR503 (PRG item a.3)

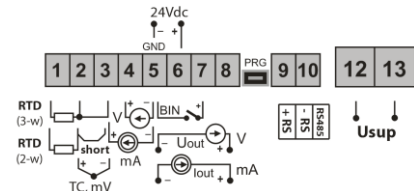

a.2) in AR500 (PRG item a.3)



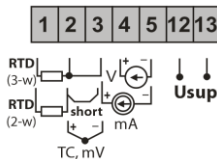


a.3) AR500, AR503 (PRG adapter connected)

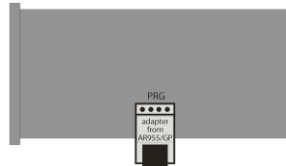

NOTE: For connecting the device with a computer through the **PRG** socket, use only the **AR955** programmer (for AR500 and AR503 with an optional adapter). A connection made with a regular USB cable may cause damage to the equipment. In AR500 and AR503, the PRG input is accessible from the top of the enclosure. Place the adapter in the opening in the enclosure with the USB socket facing the nearest wall of the enclosure.

b) connection of a 2- and 3-wire transducer (Iout - output current, Uout - output voltage)

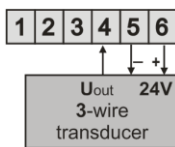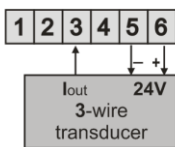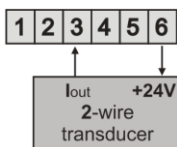

8. FUNCTIONS OF BUTTONS. MINIMUM AND MAXIMUM VIEW


a) Description of the front side using the example of the AR517 device



a 7-segment LED display

programming buttons

b) AR500

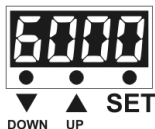





c) AR503






In AR500 and AR503, the buttons are accessible after the front glass is removed.

a) button functions in the measurement display mode

Button	Description [and marking in the contents of the instructions]
or	[UP] or [DOWN]: changes the preset value for the alarm (parameter 6: SEt 4) or the analog output working in the manual mode 12: HSEt , see chapters 10 and 12.3

	[SET]: - output in the quick access menu (chapter 11)
	[UP] and [DOWN] (at the same time): input in the parameter configuration menu (after hold time longer than 1 s). If parameter 14: PPro = on (password protection is activated) enter the access code (chapter 10)
	[SET] and [UP] : - displays the saved MAXIMUM VALUE of the measurement - deletes the maximum value of the measurement (after hold time > 6 s)
	[SET] and [DOWN] : - displays the saved MINIMUM VALUE of the measurement - deletes the minimum value of the measurement (after hold time > 6 s)


b) button functions in the parameter configuration menu and the quick access menu (chapters 10 and 11)

Button	Description [and marking in the contents of the instructions]
	[SET]: - edits the current parameter (the value blinks on the display) - approves and saves the edited parameter value
	[UP] or [DOWN] : - moves to the next or previous parameter - changes the value of the edited parameter
	[UP] and [DOWN] (simultaneously): - cancels the change of the edited value (and displays the parameter name again) - returns to the measurement display mode (after hold time >0.5 s)

9. BINARY INPUT

Binary input **BIN** (not available in the AR500) performs a function that is programmable with parameter 15: **Func** (chapter 10). The binary input works with the bi-stable signal i.e. the supplied signal (voltage or switch) must be permanent (on/off type). Activation of the function is indicated by appropriate messages on the display (described below).

Available **BIN** input functions

Source	Description (depending on the value of parameter 15: Func)	Message	
	Func = none	the BIN input is inactive (factory setting)	-
	Func = block	keypad block	block / boFF
	Func = hAnd	unconditional manual mode for the analog output	hAnd / hoFF
	Func = hold	stopping the display indications (HOLD function)	hold / hoLd

10. SETTING OF THE CONFIGURATION PARAMETERS

All the controller's configuration parameters are saved in a non-volatile (permanent) internal memory.

When the device is switched on for the first time, an error message may be shown in the display due to the lack of a sensor or the fact that the connected sensor is not factory-programmed. In such an event, the proper sensor or analog signal must be connected and the configuration must be programmed.

There are two parameter configuration methods:

1. From the film keypad located on the front panel of the device:

(in AR500 and AR503, the buttons are accessible after the front glass is removed)

- enter in the configuration menu from the mode where the input measurements are displayed (press the **[UP]** and **[DOWN]** buttons simultaneously for more than 1 s) If parameter 14: **PRPo** = **on** (password protection is activated) then the display shows the message **Code**, and then **0000** with the first digit blinking, use buttons **[UP]** or **[DOWN]** to enter the password (default parameter 13: **PASS** = **1111**), move to successive positions or approve the code using the **[SET]** button
- after entering the configuration menu (with message **Conf**) the display shows the mnemonic name of the parameter (**inp** <-> **File** <-> **date** <-> etc.)
- by pressing the **[UP]** button, one can move to the next parameter, and by pressing the **[DOWN]** button - to the previous parameter (the list of the configuration parameters is presented in Table 10)
- to change the value of the current parameter, press briefly the **[SET]** button (the parameter blinks in the edition mode)
- use buttons **[UP]** or **[DOWN]** to change the value of the edited parameter
- approve the changed value of the parameter by pressing the **[SET]** button; cancel it by pressing the **[UP]** and **[DOWN]** buttons (simultaneously and for a short moment); then parameter name is displayed again
- to exit the configuration: press the **[UP]** and **[DOWN]** buttons for a long moment or wait approx. 2 minutes

2. Use the RS485 or the PRG port (AR955 programmer) and the ARSOFT-WZ1 software (chapter 14):

- connect the meter to a computer port and start and configure the ARSOFT-WZ1 application
- after the connection has been established, the current measured value is displayed in the window of the software
- setting and viewing of the device parameters is possible in the parameter configuration window
- new parameter values must be approved with the **Approve changes** button
- the current configuration can be saved in a file or set using values read from a file
- a file with finished configuration can also be created using the ARSOFT-WZ4 software (chapter 14)

NOTE:



- before disconnecting the device from a computer, press the **Disconnect device** button (ARSOFT-WZ1)
- in the event of no response:
 - in the **Program options** check the configuration of the port and the **MODBUS Address of the device**
 - make sure that the serial port drivers in the computer have been properly installed for the RS485 converter or the AR955 programmer
 - disconnect for a few seconds and then reconnect the RS485 converter or the AR955 programmer
 - restart the computer

In the event of indications different than the actual value of the input signal, the zero and the sensitivity of a sensor can be tuned: parameters 21: **RL0** (zero) and 22: **RL1** (sensitivity).

To restore the factory settings, when the power supply is switched on press buttons **[UP]** and **[DOWN]** and hold them until the password menu appears (**Code**), and then enter the following code **0112**.

As an alternative, a file with default configuration can be used in the ARSOFT-WZ1 software.


NOTE:



Do not perform configuration of the device with the keypad and through the serial interface (RS485 or AR955) at the same time.

Table 10. List of configuration parameters

Parameter	Range of variability of the parameter and description		Factory settings
0: inP Type of measurement input	PE	thermoresistance sensor (RTD) Pt100 (-200 ÷ 850°C)	PE
	NI	thermoresistance sensor (RTD) Ni100 (-50 ÷ 170°C)	
	PE5	thermoresistance sensor (RTD) Pt500 (-200 ÷ 620°C)	
	PE10	thermoresistance sensor (RTD) Pt1000 (-200 ÷ 520°C)	
	EC-J	thermoelectric sensor (thermocouple) type J (-40 ÷ 800°C)	
	EC-K	thermoelectric sensor (thermocouple) type K (-40 ÷ 1,200°C)	
	EC-S	thermoelectric sensor (thermocouple) type S (-40 ÷ 1,600°C)	
	EC-B	thermoelectric sensor (thermocouple) type B (-300 ÷ 1,800°C)	
	EC-R	thermoelectric sensor (thermocouple) type R (-40 ÷ 1,600°C)	
	EC-T	thermoelectric sensor (thermocouple) type T (-25 ÷ 350°C)	
	EC-E	thermoelectric sensor (thermocouple) type E (-25 ÷ 820°C)	
	EC-N	thermoelectric sensor (thermocouple) type N (-35 ÷ 1,300°C)	
	4-20	current signal 4 ÷ 20 mA	
	0-20	current signal 0 ÷ 20 mA	
	0-10	voltage signal 0 ÷ 10 V	
0-60	voltage signal 0 ÷ 60 mV		
RES	resistance signal 0 ÷ 2,500 Ω		
PRPo	remote input from the RS485 or PRG port, chapter 16, Table 16.6		
1: FILT filtration (1)	1 ÷ 20	digital filtration of measurements (response time)	5
2: dot position of the point/resolution	0	no point (2) or 1°C for temperature	1 (0.1 °C)
	1	0.0 (2) or resolution 0.1 °C for temperature	
	2	0.00 (2)	
	3	0.000 (2)	
3: Lo lower limit or bottom of the indication range (2)	4999 ÷ 9999	indication 0/4 mA, 0 V, 0 Ω - start of the input scale (2)	4999 °C
	4999 ÷ 1800	lower setting limit for the preset value of the alarm 6: SEt	
4: Hi upper limit or top of the indication range	4999 ÷ 9999	indication for 20 mA, 10 V, 60 mV, 2,500 Ω - end of the input scale (2)	8500 °C
	4999 ÷ 1800	upper setting limit for the preset value of the alarm 6: SEt	
ALARM CONFIGURATION - chapter 12 (parameters insignificant to the AR500)			
5: out alarm type	off	alarm constantly off	off
	inU reverse/heating	<p>Figure 10.1. Characteristics of heating type alarm</p>	

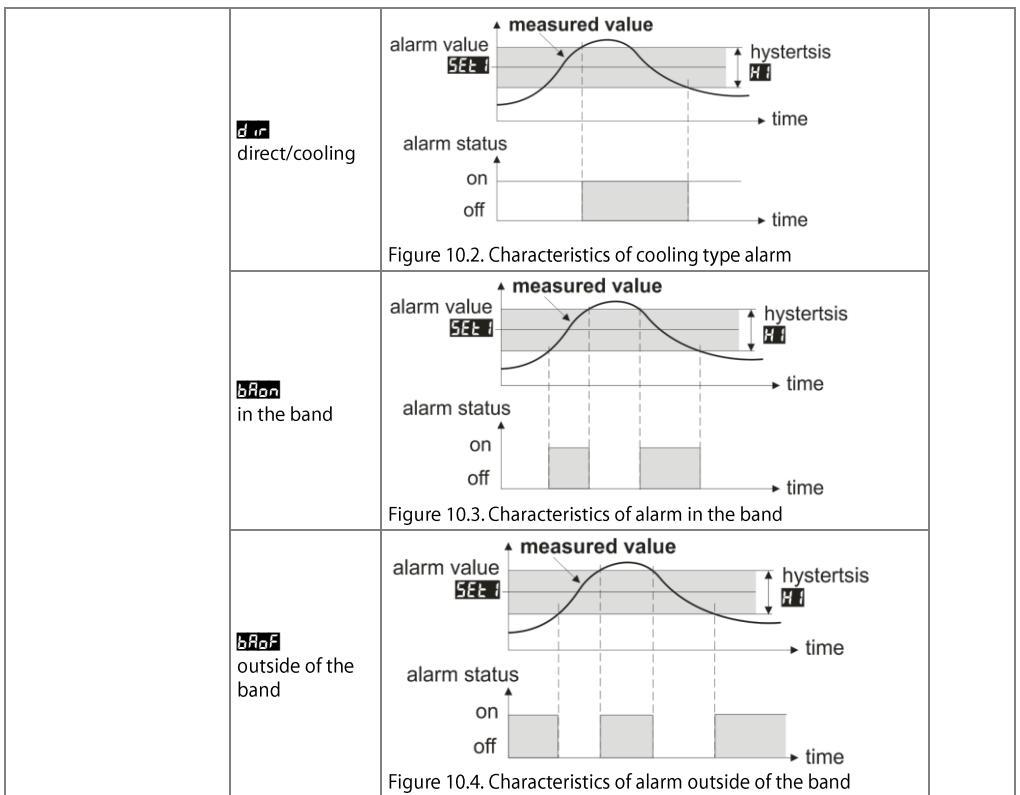

6: SEt alarm value	changes in range 3: Lo ÷ 4: H	1000 °C
7: H alarm hysteresis	00 ÷ 9999 °C or 0 ÷ 9999 units (2)	10 °C

ANALOG OUTPUT CONFIGURATION (chapter 12.2, parameters insignificant to the AR500)

8: RAoP type of analog output	depending on the order code: for current output 0-20 or 4-20 mA, for voltage output 0-10 or 0-10 V	0-20 mA (0-10 V)
9: oVtR function of analog output	oFF = off, hAnd = manual mode, rEtr = retransmission of measurement, ALAr = alarm/control output, a detailed description is provided in chapter 12.2	oFF
10: R-L lower indication for retransmission	start of the output scale - for output signal value 0/4 mA or 0/2 V (the parameter is active only for measurement retransmission when 9: oVtR = rEtr)	00 °C
11: R-H upper indication for retransmission	end of the output scale - for output signal value 20 mA or 10 V (the parameter is active only for measurement retransmission when 9: oVtR = rEtr)	1000 °C
12: MS preset value of the manual mode	0 ÷ 100 % 1% step	control value for the analog output operating in the manual mode, chapters 12.2 and 12.3 50 %

ACCESS, DISPLAY, AND COMMUNICATION OPTIONS AND OTHER CONFIGURATION PARAMETERS

13: PA55 password	0000 ÷ 9999	password for the parameter configuration menu	1111
14: PPr protection of the configuration with a password	oFF	entry into the configuration menu is not password-protected	oN
	oN	entry into the configuration menu is password-protected	oN
15: Func the BIN input function	nonE	the BIN input is inactive	nonE
	blOc	keypad block	nonE

(chapter 9, parameter insignificant to the AR500)	hArA	unconditional manual mode for the analog output		
	hold	stopping the display indications (HOLD function)		
16: br ID illumination brightness	50 ÷ 100 %	brightness of the display, a 50% increase		100 %
17: colD basic color	GrEE = green, YEL = yellow, oRAn = orange,			rEd
18: Rcol alarm color	AmBE = amber, rEd = red, colD = basic (only for 18: Rcol) (18: Rcol - display color for connected alarm) (3)			Rcol
19: Addr MODBUS-RTU address	1 ÷ 247	individual address of the device in the RS485 network (chapter 16)		1
20: br speed for RS485	24 kbit/s	48 kbit/s	96 kbit/s	192 kbit/s
	384 kbit/s	576 kbit/s	1152 kbit/s	
21: ARL calibration of the zero	zero offset for measurements: -500 ÷ 500 °C or -500 ÷ 500 units (2)			0.0 °C
22: ARL gain	95.0 ÷ 115.0 %	Slope calibration (sensitivity) for measurements		100.0 %

Notes: **(1)** – for **Filt** = **1** the response time is equal to 0.25 s, for **Filt** = **20** it is equal to at least 3 s. A higher degree of filtration means a more "smooth" measured value and a longer response time, which is recommended in the case of turbulent measurements (e.g. water temperature in a boiler)
(2) – applies to analog inputs (mA, V, mV, Ω)
(3) – a non-significant parameter for AR500, AR503, and AR518 (as the display is a single-color one)

11. QUICK ACCESS MENU

In the measurement mode (when the measured value is displayed), it is possible to immediately access certain parameters without the need to enter a password. This possibility is offered by the quick menu, which can be accessed by pressing the **[SET]** button. The parameter is selected and edited in the same way as described above (in chapter 10).

Table 11. List of elements accessible in the quick configuration menu.

Element	Description
SEt 1	preset alarm value (parameter 6: SEt 1), optional element - unavailable when parameter 5: but 1 = OFF
MSEt	preset value of the manual mode (12: MSEt), optional element - available in the manual operation mode

12. ANALOG OUTPUT AND ALARM CONFIGURATION

The programmable architecture of the meter enables using it in many fields and applications. Before the operation of the device starts, it is necessary to set the parameters according to specific requirements (chapter 10).

A detailed description of configuration of the operation of the analog output and the alarm is given in chapters 12.1- 12.3. The alarm can be signaled both through the analog output (not available in the AR500) and through variable color of the display (parameter 18: **Rcol** only in the AR517). The default (factory) configuration is the following: the analog output and the alarm are switched off (Table 10, *Factory settings* column).

12.1. CHANGING THE PRESET VALUE FOR THE ALARM AND THE MANUAL MODE

In the measurement mode, the display shows the value being measured. The simplest way to change the preset value for the alarm or the manual mode (parameter 6: **SEt 1** or 12: **MSEt** when the analog output is in the manual mode) is to use the **[UP]** button or the **[DOWN]** button. As an alternative, it is possible to change the preset value in the parameter configuration mode (using the methods described in chapter 10).

12.2. ANALOG OUTPUT

The standard of the output signal is determined by parameter 8: **RLYP** (chapter 10, table 10). The analog output can work in one of the following modes: retransmission of measurement (parameter 9: **OUTA = FEEL**), manual mode (9: **OUTA = hAnd**) and as an alarm/control output (9: **OUTA = RLAR**).

In the measurement retransmission mode, the output signal is proportional to the measured signal in the range set by parameters 10: **R-Ld** and 11: **R-Hd**, (e.g. 0 mA for the measured value 0°C when **R-Ld** = 0 °C, 20 mA for 100 °C when **R-Hd** = 100 °C and, as appropriate, 10 mA for the half of the range, i.e. 50 °C).

Manual operation (chapter 12.3) makes it possible to change the output signal in the range of 0 ÷ 100% with a 1% step.

In the alarm/control output mode, the alarm/control parameters are mandatory

(the following apply: 5: **OUTI**, 6: **SEEL**, 7: **HdI**). In the alarm/control mode, the range of variability of the analog signal is **not** continuous and the output assumes limit values (lower or upper, e.g. 0 mA or 20 mA), without intermediate values. The analog output is not available in the AR500.

12.3. MANUAL AND REMOTE CONTROL FUNCTION

The manual mode enables setting the value of the output signal in the entire range of its variability (0-100%), thus enabling operation in an open regulation loop (no automatic coupling between the measured value and the output signal). Manual operation is available for the analog output of the meter and is programmed using parameters 9: **OUTA**, chapter 10, Table 10. Also, the output can be configured for quick (unconditional) manual mode controlled by the **BIN** binary input, by programming parameter 15: **Func** for the value **hAnd** (chapter 9).

The preset value of the manual mode (parameter 12: **USEE**) can be set directly using the **[UP]** or **[DOWN]** button or using the quick menu (chapter 11), or alternatively, in the parameter configuration mode (from the film keypad of the meter or remotely using the RS485 or PRG serial port, chapters 10, 14 ÷ 16).

13. MESSAGE AND ERROR SIGNALING

a) measurement errors:

Code	Possible causes of error
----	- the measurement range of the sensor is exceeded from the top (----) or from the bottom (----)
----	- the sensor is broken
----	- the sensor that is connected is different than the one that is set in the configuration (chapter 10, parameter 0: inA)

b) temporary messages and errors (one-time and recurring):

Code	Description of message
CodeE	mode of entering the password for access to the configuration parameters, chapter 10
Errr	the password is invalid
ConF	access to the parameter configuration menu
blOc / boFF	keypad block on/off, chapter 9
hAnd / hoFF	unconditional manual mode on/off, chapter 9
hoLd / hdoF	stopping of display indications (HOLD function) on/off, chapter 9
SAvE	saving of factory parameter values (chapter 10)

14. CONNECTING THE CONTROLLER TO A COMPUTER AND AVAILABLE SOFTWARE

It may be useful (or necessary) to connect the meter to a computer in the following situations:

- remote monitoring and recording of current measurement data and control of the status of the analog output
- quick configuration of parameters, to include copying of settings to other meters of the same type

In order to establish communication over long distances, it is necessary to establish a connection in the RS485 standard with an available port in the computer (directly or using an RS485 converter), as described in chapter 15. Moreover, as a standard, the meters are equipped with a PRG port which enables connecting to a computer using an AR955 programmer (without galvanic separation, cable length approx. 1.2 m). Both the programmer and the RS485 converter require installation of the supplied serial port drivers on the computer.

Communication with devices is effected using a protocol compatible with MODBUS-RTU (chapter 16).

The following applications are available (on a CD supplied with the AR955 programmer or to be downloaded from the Internet at www.apar.pl, Download section, for operating systems Windows 2000/XP/Vista/7/8):


Name	Software description
ARSOFT-WZ1 (free)	<ul style="list-style-type: none"> - display of current measurement data from the connected device - configuration of the type of measurement input, the indication range, the alarm options display communication, and access options, etc. (chapter 10) - creation of a disk with a "cfg" extension, containing the current configuration of the parameters to be used again (duplication of configuration) - the program requires communication with the meter via the RS485 or PRG (AR955) port
ARSOFT-WZ4 (free)	<ul style="list-style-type: none"> - creation on the disk of a ready configuration file with a "cfg" extension enabling programming the meter in the future using the RS485 interface or the AR955 and ARSOFT-WZ1 programmer - the program does not use communication with the meter
ARSOFT-WZ2 (payable)	<ul style="list-style-type: none"> - display and recording of current measurement data from a maximum of 30 channels at the same time (only from devices made by APAR) - the program requires communication with the meter via the RS485 or PRG (AR955) port

The detailed descriptions of the aforementioned applications can be found in the installation folders.

NOTE: 

Before establishing the connection, make sure that the MODBUS address of the device (parameter 19: **Addr**) and the speed of transmission (20: **br**) are the same as the settings of the software. Moreover, in the software, set the number of the COM serial port in use (in the case of the RS485 converter or the AR955 programmer it is the number assigned by the operating system during installation of the drivers).

15. RS485 COMMUNICATION INTERFACE (acc. to EIA RS-485)

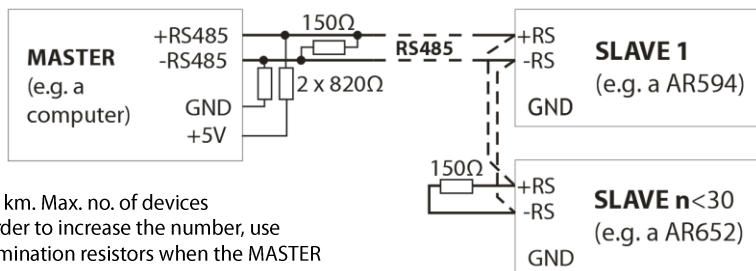

Max. RS485 cable length – 1 km. Max. no. of devices in the RS485 line – 30 – in order to increase the number, use RS485/RS485 amplifiers. Termination resistors when the MASTER is at the start of the line (fig. above):

- at the start of the line – $2 \times 820 \Omega$ to the ground and +5 V MASTER and 150Ω between the lines;
- at the end of the line – 150Ω between the lines.

Termination resistors when the MASTER is in the middle of the line:

- at the converter – $2 \times 820 \Omega$ to the ground and +5 V converter;
- at both ends of the line – 150Ω each between the lines.

16. MODBUS–RTU SERIAL TRANSMISSION PROTOCOL (SLAVE)

Character format: 8 bits, 1 stop bit, no parity bit

Available functions: READ - 3 or 4, WRITE - 6

Table 16.1. Claim frame format for the READ function (frame length - 8 bytes):

address of the device	function 4 or 3	read register address: 0 ÷ 39 (0x0027)	number of read registers: 1 ÷ 40 (0x0028)	CRC check sum
1 byte	1 byte	2 bytes (HB-LB)	2 bytes (HB-LB)	2 bytes (LB-HB)

Example 16.1. Reading of a register with address 0: 0x01 - 0x04 - 0x0000 - 0x0001 - 0x31CA

Table 16.2. Claim frame format for the WRITE function (frame length - 8 bytes):

address of the device	function 6	write register address: 0 ÷ 39 (0x0027)	write register value	CRC check sum
1 byte	1 byte	2 bytes (HB-LB)	2 bytes (HB-LB)	2 bytes (LB-HB)

Example 16.2. Entry in a register with address 10 (0xA) with the 0 value: 0x01 - 0x06 - 0x000A - 0x0000 - 0xA9C8

Table 16.3. Response frame format for the READ function (minimum frame length - 7 bytes):

address of the device	function 4 or 3	number of bytes in the data field (max. $40 \times 2 = 80$ bytes)	data field - register value	CRC check sum
1 byte	1 byte	1 byte	2 ÷ 80 bytes (HB-LB)	2 bytes (LB-HB)

Example 16.3. Response frame for register value equal to 0: 0x01 - 0x04 - 0x02 - 0x0000 - 0xB930

Table 16.4. Response frame format for the WRITE function (frame length - 8 bytes):

copy of the claim frame for the WRITE function (Table 16.2)

Table 16.5. Special response (errors: function field = 0x84 or 0x83 in the case of the READ function and 0x86 in the case of the WRITE function):

Error code (HB-LB in the data field)	Error description
0x0001	non-existing register address
0x0002	wrong write register value
0x0003	improper function number

Example 16.5. Error frame for a non-existing read register address: 0x01 - 0x84 - 0x02 - 0x0001 - 0x5130

Table 16.6. Map of registers for the MODBUS-RTU protocol

Register address HEX (DEC)	Value (HEX or DEC)	Description of register and access type (R- read only register, R/W - read and write register)	
0x00 (0)	-1999 ÷ 19999	current measurement value	R/W
	-1999 ÷ 9999	value to be displayed for the remote input (when parameter 0: $\overline{mP} = \overline{rER0}$)	
0x01 (1)	517	device type identifier	R
0x02 (2)	100 ÷ 999	meter software (firmware) version	R

0x03 ÷ 0x05	0	not used or reserved	R
0x06 (6)	0 ÷ 1	current alarm status: bit0, bit0=1 means that the alarm is on	R
0x07 (7)	0 ÷ 20000	current state of the analog output (0 ÷ 20000 µA or 0 ÷ 10000 mV)	R
0x08 (8)	-100 ÷ 700	thermocouple cold tip temperature (resolution 0.1°C)	R
0x09 (9)	-1999 ÷ 19999	minimum measurement value	R
0x0A (10)	-1999 ÷ 19999	maximum measurement value	R
0x0B ÷ 0x10	0	not used or reserved	R
Configuration parameters (chapter 10)			
0x11 (17)	0 ÷ 17	parameter 0: inp type of measurement input (chapter 10)	R/W
0x12 (18)	1 ÷ 20	parameter 1: fil digital filtration of measurements (response time)	R/W
0x13 (19)	0 ÷ 3	parameter 2: pos position of the point or resolution for temperature	R/W
0x14 (20)	-1999 ÷ 18000	parameter 3: low lower limit for the alarm or bottom of the indication range	R/W
0x15 (21)	-1999 ÷ 18000	parameter 4: high upper limit for the alarm or top of the indication range	R/W
0x16 (22)	0 ÷ 4	parameter 5: out alarm type	R/W
0x17 (23)	-1999 ÷ 18000	parameter 6: set preset value for the alarm	R/W
0x18 (24)	0 ÷ 9999	parameter 7: hys alarm hysteresis	R/W
0x19 (25)	0 ÷ 1	Parameter 8: outp type of analog output	R/W
0x1A (26)	0 ÷ 3	parameter 9: outf function of analog output	R/W
0x1B (27)	-1999 ÷ 18000	parameter 10: rl lower indication for retransmission	R/W
0x1C (28)	-1999 ÷ 18000	parameter 11: rh upper indication for retransmission	R/W
0x1D (29)	0 ÷ 100	parameter 12: setm preset value of the manual mode	R/W
0x1E (30)	0 ÷ 9999	parameter 13: pass password	R/W
0x1F (31)	1 ÷ 2	parameter 14: ppro protection of the configuration with a password	R/W
0x20 (32)	0 ÷ 3	parameter 15: funcBIN input function	R/W
0x21 (33)	20 ÷ 100	parameter 16: br id brightness of the display, a 50% increase	R/W
0x22 (34)	0 ÷ 4	parameter 17: col basic color of the display	R/W
0x23 (35)	0 ÷ 5	parameter 18: rcol alarm color of the display	R/W
0x24 (36)	1 ÷ 247	parameter 19: addr MODBUS-RTU address in the RS485 network	R/W
0x25 (37)	0 ÷ 6	parameter 20: br speed for RS485	R/W
0x26 (38)	-500 ÷ 500	parameter 21: rla zero offset for measurements	R/W
0x27 (39)	850 ÷ 1150	parameter 22: rls Slope calibration (sensitivity) for measurements	R/W

17. USER'S NOTES